



# IEC 61850 Certificate Level A<sup>1</sup>

International  
Usersgroup

No. 30720460-Consulting 07-1363

Issued to:  
Siemens A.G., PTD EA  
Protection and Substation Control Systems  
Wernerwerkdammm 5  
D-13623 Berlin  
Germany

For the product:  
Siprotec V4  
6MD63 Medium Voltage Bay Unit  
Firmware V04.64  
EN100 V04.00



The product has not shown to be non-conforming to:  
**IEC 61850-6, 7-1, 7-2, 7-3, 7-4 and 8-1**  
Communication networks and systems in substations

The conformance test has been performed according to IEC 61850-10 with product's protocol, model and technical issue implementation conformance statements: "SIPROTEC 4 Ethernet Module EN100 IEC 61850 Electrical / Optical Interface 100 MBit Manual, Edition May 2007, C53000-G1100-C167-7", "MICS, Mapping family 7SJ6XX, Mappingversion 1 Revision 65" and product's extra information for testing: "SIPROTEC Input / Output Unit with Local Control 6MD63 V4.6 IEC 61850 PIXIT, C53000-G1140-C185-2".


The following IEC 61850 conformance blocks have been tested with a positive result (number of relevant and executed test cases / total number of test cases as defined in the UCA International Users Group Device Test procedures v2.2):

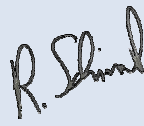
1 Basic Exchange (19/24)	9ab Generic Object Oriented Substation Event (16/22)
2+ Data Set Definition (26/29)	12a Direct Control (5/12)
5 Unbuffered Reporting (15/18)	12d Enhanced SBO Control (12/20)
6 Buffered Reporting (16/20) <sup>2</sup>	13 Time Synchronization (3/5)

This Certificate includes a summary of the test results as carried out at in with UniCASim 61850 version 3.16.00 with test suite 3.16.01 and UniCA 61850 analyzer 4.15. The test is based on the UCA International Users Group Device Test Procedures version 2.2. This document has been issued for information purposes only, and the original paper copy of the KEMA report: No. 30720460-Consulting 07-1362 will prevail.

The tests have been carried out on one single specimen of the product as referred above and submitted to KEMA by Siemens. The manufacturer's production process has not been assessed. This Certificate does not imply that KEMA has certified or approved any product other than the specimen tested.

Arnhem, October 11, 2007

  
S.J.J. M. Janssen  
Managing Director KEMA Consulting

  
R. Schimmel  
Certification Manager

<sup>1</sup> Level A - Independent Test lab with certified ISO 9000 or ISO 17025 Quality System  
<sup>2</sup> Buffered reporting may cause interoperability issues due to implementation of tissue #453



Applicable Test Procedures from the UCA International Users Group Device Test Procedures version 2.2

Conformance Block	Mandatory	Conditional
1: Basic Exchange	Ass1, Ass2, Ass3, AssN2, AssN3, AssN4, AssN5 Srv1, Srv2, Srv3, Srv4, Srv5, SrvN1abcd, SrvN4	Srv6, Srv7, Srv8, SrvN1e, SrvN3
2: Data Sets	Dset1, Dset10a, DsetN1ae	
2+: Data Set Definition	Dset2, Dset3, Dset4, Dset5, Dset6, Dset7, Dset8, Dset9 DsetN1cd, DsetN2, DsetN3, DsetN4, DsetN5, DsetN6, DsetN7, DsetN8, DsetN9, DsetN10, DsetN11, DsetN12, DsetN13, DsetN14, DsetN15	
5: Unbuffered Reporting	Rp1, Rp2, Rp3, Rp4, Rp7, Rp10 RpN1, RpN2, RpN3, RpN4	Rp5, Rp6, RpN5, Rp8, Rp9
6: Buffered Reporting <sup>3</sup>	Br1, Br2, Br3, Br4, Br7, Br8, Br9, Br12, BrN1, BrN2, BrN3, BrN4, BrN5	Br5, Br10, Br11
9a: GOOSE publish	Gop2, Gop3, Gop4, Gop7, Gop10	Gop1, GopN1
9b: GOOSE subscribe	Gos1a, Gos2, Gos3, GosN1, GosN2, GosN3, GosN4, GosN5, GosN6	
12a Direct control	CtlN3, CtlN8 DOs1, DOs3	Ctl2
12d: Enhanced SBO Control	Ctl3, CtlN1, CtlN2, CtlN3, CtlN4, CtlN9 SBOes1, SBOes2, SBOes3	Ctl2, Ctl7, CtlN11
13: Time Sync	Tm1, Tm2, TmN1	

<sup>3</sup> Buffered reporting tissue #453 has successfully been tested, compare test report for details